



# G360 SUPER FAST COMPOUND.

~~P3000~~



## Product Description

G360 Super Fast Compound used with a G Mop Super High Cut Pad easily glides over the surface and eliminates P1500 sanding marks rapidly and with little effort. This removes the need for P3000 abrasive discs, saving time and money. It is transparent in use, enabling the operator to see scratch marks disappear permanently.

Using this compound with a G Mop Flexible Yellow Compounding Foam eliminates all holograms and removes swirl marks leaving a great finish on lighter colours.

For darker colours, the operator may wish to use G360 Super Fast Finish with a G Mop Flexible Black Finishing Foam. This removes any fine swirls and enhances the gloss level.

## Product Information

Size	Code	Ctn Qty
1kg	SFC101	6

## Key Benefits

### NO P3000 REQUIRED

Super fast results on P1500 sanding marks, eliminating the need for expensive and time consuming P3000 abrasive discs

### SUPER FAST CUT

Unique abrasive technology that contains no fillers or silicones, removing P1500 sanding marks permanently

### TRANSPARENT IN USE

Unlike P3000 which can mask P1500 process marks, G360 is transparent in use, allowing the operator to see the sanding marks being removed

### PERMANENT

G360 contains no fillers, so gives permanent results, avoiding costly reworks

### FEWER PRODUCTS

Not only are P3000 discs no longer needed, but a single bottle of G360 Compound covers two process steps

LIT1998 (V1 08-2018)




+44 (0) 1920 465 041  
enquiries@farecla.com  
www.farecla.com

**Farécla** SURFACE FINISHING SPECIALISTS


## Step 1: HIGH CUT




### Remove P1500 sanding marks, permanently

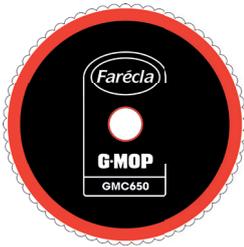


G Mop Super High  
Cut Pad  
**GMC650**  
(6" / 150mm)

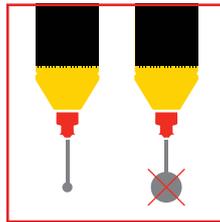


Only a small  
amount needed

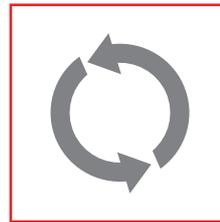

Cut at 1500rpm - light pressure  
End at 900rpm - no pressure

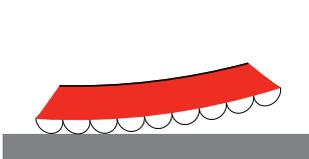


CUT AT 1500RPM - SLIGHT  
ANGLE - LIGHT PRESSURE

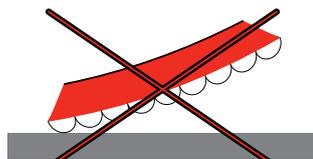

NOT TOO ANGLED



END AT 900RPM -  
USE FLAT - NO PRESSURE

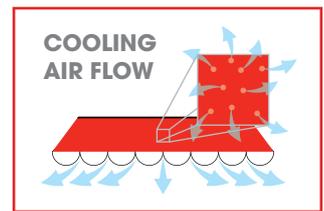

COOLING  
AIR FLOW


## Step 2: MEDIUM CUT




### Remove process marks - swirls and holograms, permanently



G Mop Flexible Yellow  
Compounding Foam  
**GMC624**  
(6" / 150mm)

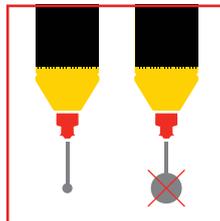


Only a small  
amount needed

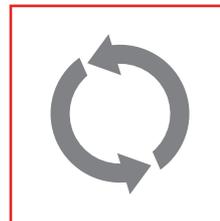

900 - 1300rpm



Wipe clean  
**FC-3**

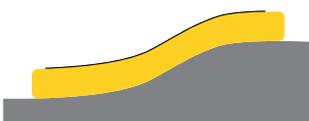

FLEXIBLE FOR  
EASY HANDLING

## Tips



### FOR BEST RESULTS AND LONGER PAD LIFE

G Mop Flexible Back Plate  
for 6" Pads

**GMB146** (14mm thread)

**GMB586** (5/8" thread)

**GMB166** (16mm thread)



### PRIME THE G MOP SUPER HIGH CUT PAD USING ONLY A SMALL AMOUNT OF PRODUCT.

**SPUR PADS FREQUENTLY TO AVOID  
CLOGGING AND MAXIMISE PAD LIFE.**

G Mop Spurring Brush

**1090005**